


# E4-VL-LR3

Now Includes .371 Line Boost Valve & Bushing!

Fixes: The common wear areas in the E4OD/4R100 Accumulator Body with 1 product!

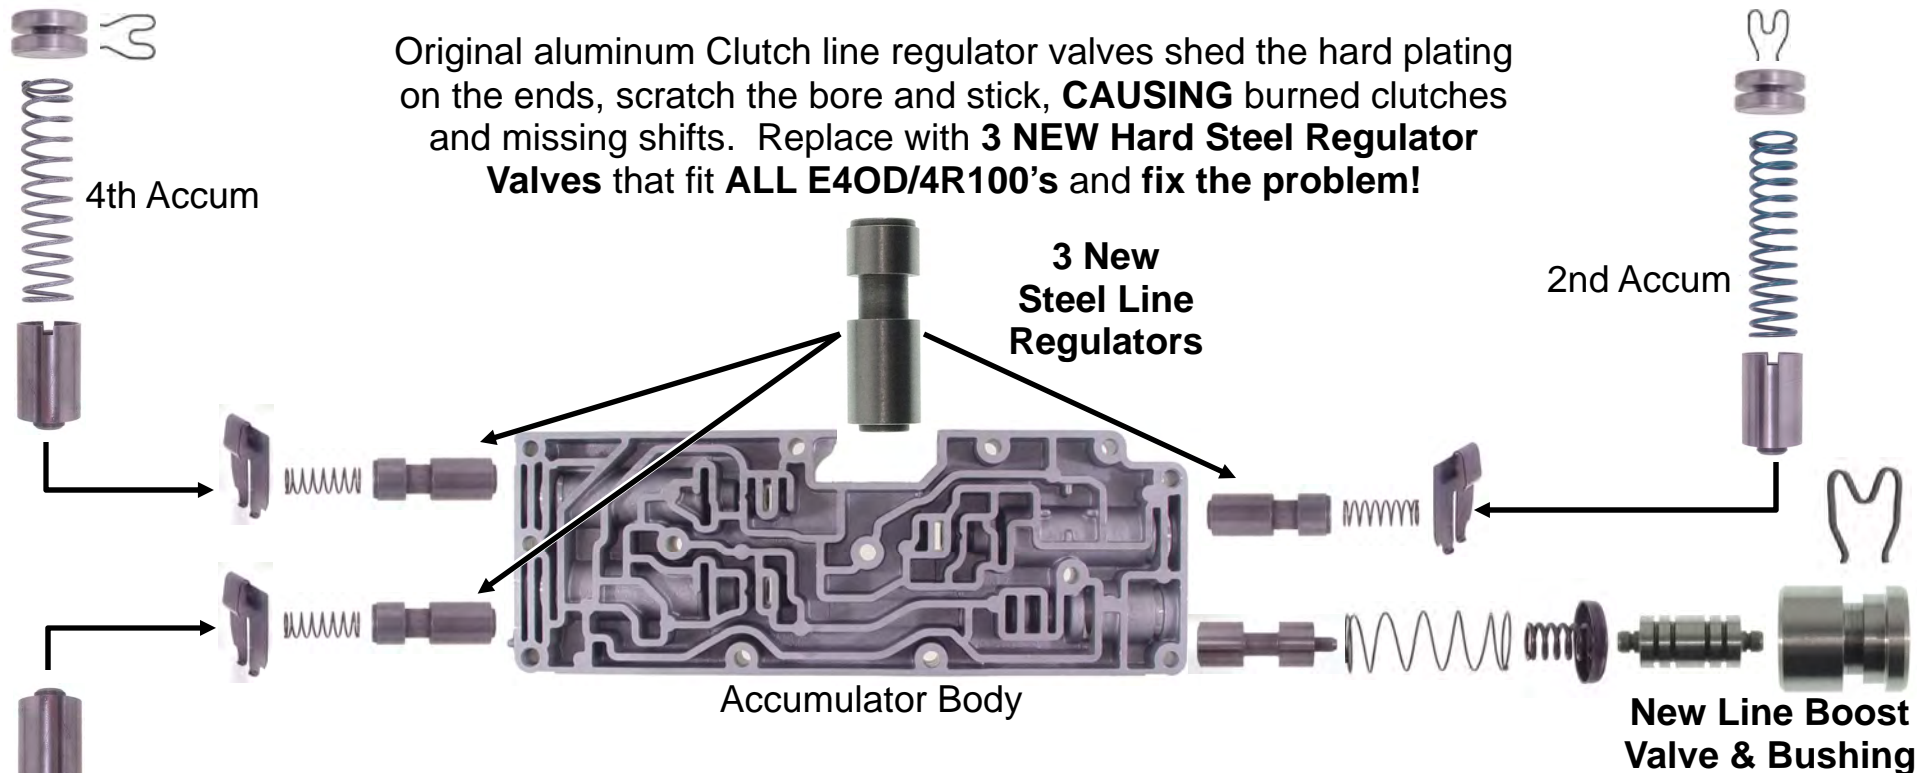

**NEW STEEL: Line Boost Valve & Bushing** replaces worn original equipment .372 diameter aluminum valve & bushing that can cause soft shifts.

Not recommended on **6 cyl units equipped** with the smaller .331 valve, as shifts will be unusually rough. **Re-use** the original .331 line boost valve (if it's not worn out)!




Here's Another EASY Fix  
for an Annoying Problem:

## E4-VL-23


### Three Steel 2-3 Shift Valves

Replacement 2-3 Shift valve for Casting  
code F6 E4OD and 4R100 valve bodies.  
Fixes repeated stuck 2-3 shift valve that  
Causes no 3rd or 4th but reverse is OK.

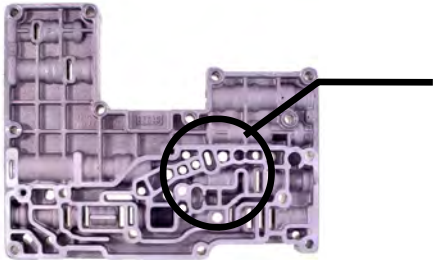

Fits Valve bodies with 2  
or 3 SMALL balls located  
in this area and has F6  
or F8 code on main VB.

**Remove old 2-3 valve and spring. Re-use retainer.  
Install New TransGo® Valve and Blue Spring.  
THAT'S IT!**

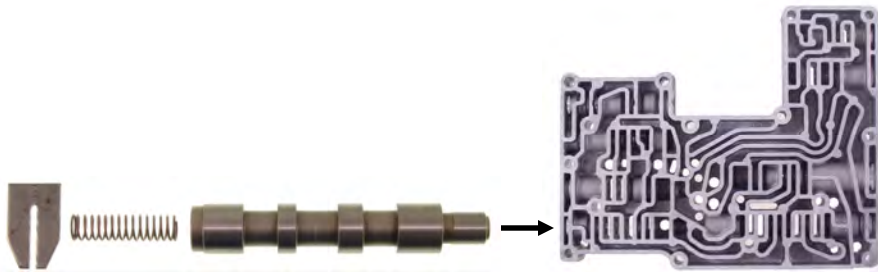

Order from your supplier P/N **E4-VL-23**  
Fixes 3 transmissions!